www.fsaservice.com/forms/warranty.pdf

FULLSPECTRUM

GROUP, LLC

How likely are you to recommend Full Spectrum?

1 2 3 4 5 6 7 8 9 10

		SITE	BILL TO:		
LOCATION					
City of Scottsdale, Police Department 7601 East McKellips Road, Scottsdale, AZ 85257 United States Mr. Phillip Brooke, pbrooke@scottsdaleaz.gov			Customer		
Service Rep: Iribe, Victor		Service Type: Repair		Quality Level: Standard	
Billing Type: Non-Billable		Payment Method: Service Contract		PO#: N/A	
System ID	Manufactur	er	Model		Serial#
GC w/ HS	Agilent		G4556A		US14173023
Additional Instruments					

## PROBLEM DESCRIPTION:

PH 480) 312-1281

We are experiencing inconsistent retention times. Requesting onsite engineer to troubleshoot the instrument

## **WORK PERFORMED:**

Customer reported inconsistent retention times for one of the columns. Used leak detector at the Deans switch where all columns attached. A leak was found to be at the fitting where the front column connects. Customer did not have appropriate ferules for the union, so the fitting was tightened in little more to see if this would remedy their issue. Customer will contact back to see if retention times have stabilized. They will also order more Flexi-Tight metal ferrules for their Dean switch.

Parts Total:

HOURS	RATE	TOTAL	
Labor Hours: 4.0	Labor Rate: \$376	Labor Total:	\$1504
Travel Hours: 1.0	Travel Rate: \$376	Travel Total:	\$376
	Extended Travel: \$0	Misc. S&H:	\$0.00
		Total Labor:	\$1880
	NOT AN INVOICE, TAXES NOT	Report Total:	\$1,880.00
~i:72:100~	INCLUDED	Credit Amount:	\$1880.00
	005 1 188 04 00050 + 000 705 0057 + 54	Balance Due:	\$0.00

23332 Mill Creek, suite 205, Laguna Hills, CA 92653 \* 800-795-6357 \* FAX: 925-485-9018